

IPC-WP-113A
2021 - October
**Guidance for the
Development and
Implementation of a
Red Plague Control Plan
(RPCP)**

A White Paper Report Developed by IPC



BUILD ELECTRONICS BETTER

The Principles of Standardization

In May 1995 the IPC's Technical Activities Executive Committee (TAEC) adopted Principles of Standardization as a guiding principle of IPC's standardization efforts.

Standards Should:

- Show relationship to Design for Manufacturability (DFM) and Design for the Environment (DFE)
- Minimize time to market
- Contain simple (simplified) language
- Just include spec information
- Focus on end product performance
- Include a feedback system on use and problems for future improvement

Standards Should Not:

- Inhibit innovation
- Increase time-to-market
- Keep people out
- Increase cycle time
- Tell you how to make something
- Contain anything that cannot be defended with data

Notice

IPC Standards and Publications are designed to serve the public interest through eliminating misunderstandings between manufacturers and purchasers, facilitating interchangeability and improvement of products, and assisting the purchaser in selecting and obtaining with minimum delay the proper product for his particular need. Existence of such Standards and Publications shall not in any respect preclude any member or nonmember of IPC from manufacturing or selling products not conforming to such Standards and Publication, nor shall the existence of such Standards and Publications preclude their voluntary use by those other than IPC members, whether the standard is to be used either domestically or internationally.

Recommended Standards and Publications are adopted by IPC without regard to whether their adoption may involve patents on articles, materials, or processes. By such action, IPC does not assume any liability to any patent owner, nor do they assume any obligation whatever to parties adopting the Recommended Standard or Publication. Users are also wholly responsible for protecting themselves against all claims of liabilities for patent infringement.

IPC Position Statement on Specification Revision Change

It is the position of IPC's Technical Activities Executive Committee that the use and implementation of IPC publications is voluntary and is part of a relationship entered into by customer and supplier. When an IPC publication is updated and a new revision is published, it is the opinion of the TAEC that the use of the new revision as part of an existing relationship is not automatic unless required by the contract. The TAEC recommends the use of the latest revision. Adopted October 6, 1998

Thank you for your continued support.



IPC-WP-113A

Guidance for the Development and Implementation of a Red Plague Control Plan (RPCP)

Developed by the Wire Harness Design Task Group (7-31k)
of the Product Assurance Committee (7-30) of IPC

Supersedes:

IPC-WP-113 -
December 2015

Users of this publication are encouraged to participate in the
development of future revisions.

Contact:

IPC
3000 Lakeside Drive, Suite 105 N
Bannockburn, Illinois
60015-1249
Tel 847 615.7100
Fax 847 615.7105

This Page Intentionally Left Blank

Acknowledgment

Members of the Wire Harness Design Task Group worked to develop this document. We thank them for their dedication and service to this effort. Any document involving a complex technology draws material from a vast number of sources across many continents. While the principal members of the Wire Harness Design Task Group (7-31k) of the Product Assurance Committee (7-30) are shown below, it is not possible to include all of those who assisted in the evolution of this standard. To each of them, the members of the IPC extend their gratitude.

Product Assurance Committee

Chair

Robert W. Cooke
NASA Johnson Space Center

Vice-Chair

Debbie Wade
Advanced Rework Technology

Wire Harness Design Task Group

Chair

Robert W. Cooke
NASA Johnson Space Center

Vice-Chair

Sean Keating
Amphenol Ltd (UK)

Technical Liaison of the IPC Board of Directors

Bob Neves

Microtek (Changzhou) Laboratories

Members of Wire Harness Design Task Group

Dominik Alder
Lockheed Martin Corporation

Anisha Ankush
ATRON Group LLC

Michael Baker

Vincent Barone
Panduit Corporation

Geza Batiz
Toro Co.

Cathy Becker
JC Manufacturing

James Blanche
NASA Marshall Space Flight Center

Gerald Bogert
Bechtel Plant Machinery, Inc.

Alvin Boutte
NASA Goddard Space Flight Center

Bud Bowen
Winchester Interconnect

Lance Brack
Raytheon Missile Systems

Thomas Carle
Ball Aerospace &
Technologies Corp.

Zhiman Chen
Zhuzhou CRRC Times
Electric Co., LTD.

Thomas Cleere

Robert Cooke
NASA Johnson Space Center

Stephen Cooke
Electrical Components International

Miguel Dominguez
Continental Temic SA de CV

Bill Downton
Cirris Systems Corporation

Caroline Ehlinger
Collins Aerospace

Chris Fitzgerald
NASA Goddard Space Flight Center

Robert Fornefeld
STI Electronics, Inc.

Daniel Foster
Missile Defense Agency (MDA)

B.J. Franco
Honeywell Aerospace

Mahendra Gandhi
Northrop Grumman Space Systems

Matt Garrett
Microsemi

Constantino Gonzalez
ACME Training & Consulting

William Graver
NTS - Baltimore

Dave Harrell
Viasat Inc.

Eric Harenburg
Boeing Company

Rick Hawthorne
Technical Training Center

Gaston Hidalgo
Toyota Motor North America

David Hillman
Collins Aerospace

Shelley Holt
L3Harris Communications

Ife Hsu
Intel Corporation

Paula Jackson
Raytheon UK

Kathy Johnston

Lawrence Joy

Joseph Kane
BAE Systems

Sean Keating
Amphenol Ltd (UK)

Jason Keeping
Celestica International L.P.

Russell Kido
Practical Components Inc.

Rebekah Kovarik
Lockheed Martin

Vijay Kumar
Lockheed Martin Missiles &
Fire Control

Leo Lambert EPTAC Corporation	Sue Powers-Hartman Killdeer Mountain Manufacturing, Inc.	Stephen Tisdale Tisdale Environmental Consulting LLC
Theodore Laser L3Harris Communications	Ray Prasad Ray Prasad Consultancy Group	Jonathon Vermillion Ball Aerospace & Technologies Corp.
Evan Levy	ErViik Quam Uson LP	Daniel Versluis HYTEK
John Mastorides Honeywell Aerospace	Edward Rios Motorola Solutions	Debie Vorwald Collins Aerospace
Garry McGuire NASA Marshall Space Flight Center	Richard Rumas Honeywell Canada	Debbie Wade Advanced Rework Technology
Randy McNutt Northrop Grumman Aerospace Systems	Tammy Sargent Collins Aerospace	Schuyler Williams Lockheed Martin Missiles & Fire Control
Roger Miedico Raytheon Company	Martin Scionti Raytheon Vision Systems	Alan Young Jet Propulsion Laboratory
Brett Miller USA Harness, Inc.	Darrell Sensing BAE Systems	Style Yuan Winchester Electronics (Suzhou) Co., Ltd.
George Millman Raytheon Missile Systems	Jose Servin Olivares Vitesco Technologies	Jack Zhu Veoneer China CO.,LTD
Fernando Moreno Cesar-Scott, Inc.	Gilbert Shelby Raytheon Systems Company	Yaakov Zissman Elta Systems Ltd.
Mark Northrup Raytheon Missile Systems	Kim Souva Kearfott Corporation	Paul Zutter U.S. Army Aviation & Missile Command
Agnieszka Ozarowski BAE Systems	Toshiyasu Takei Japan Unix Co., Ltd.	
Bob Potysman ATRON Group LLC	Bob Teegarden Honeywell International - Torrance	

This Page Intentionally Left Blank

Guidance for the Development and Implementation of a Red Plague Control Plan (RPCP)

TECHNICAL BACKGROUND

Red Plague (cuprous oxide corrosion) can develop in silver-coated soft or annealed copper conductors (component leads, single and multi-stranded wires, and PCB conductors) when a galvanic cell forms between the copper base metal and the silver coating in the presence of moisture (H_2O) and oxygen (O_2). Once initiated, the sacrificial corrosion of the copper base conductor can continue indefinitely in the presence of oxygen, progressively reducing the electrical and mechanical integrity of the conductor (the degradation is particularly acute in thin conductors). The color of the corrosion by-product (cuprous oxide crystals) may vary depending on the different levels of oxygen available, but is commonly noted as a red/reddish-brown discoloration on the silver coating surface.

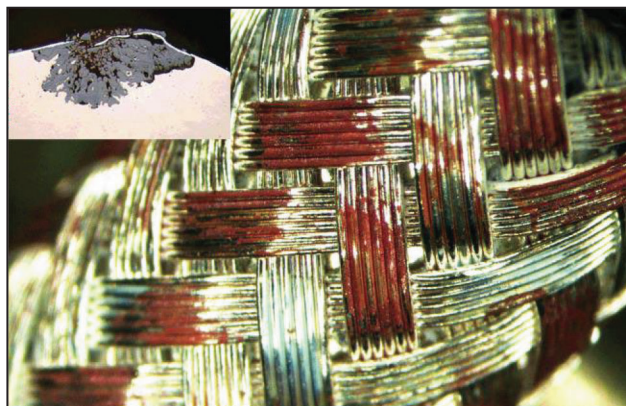


Figure 1-1 Red Plague (Cuprous Oxide Corrosion) on Braided Shield
Inset: Microsection of Single Strand (400X)

Mechanical Damage

The primary initiator of Red Plague is mechanical damage of the silver coating during wire manufacturing (e.g., drawing, stranding, application of insulation jackets) resulting in exposure of the copper-silver interface to atmospheric moisture and oxygen. Other common sources of mechanical damage include improper assembly and installation practices (e.g., excessive flexing, improper bend radius).

Environmental Conditions

In order for Red Plague to develop, a galvanic cell must form between the copper base metal and the silver coating in the presence of water (H_2O) and oxygen (O_2). Since only a small amount of water is required, protection from high humidity and oxygen and other contaminants such as aqueous solvents and cleaning systems is considered the greatest significant mitigation against Red Plague.

Inadequate Silver Coating Thickness

Porous, discontinuous, and thin silver coatings are more likely to develop Red Plague since a greater number of sites for galvanic cells to form between the copper base metal and the silver plating are possible. Silver coating thicknesses below $1\ \mu m$ [$40\ \mu in$] are more easily damaged during manufacturing and handling, thus increasing susceptibility. Increasing the silver coating thickness to $2\ \mu m$ [$80\ \mu in$] has shown improved resistance to corrosion.

High Temperature

Though the upper continuous operating temperature rating of most silver-coated wiring is $+200\ ^\circ C$ [$+392\ ^\circ F$], exposure to temperatures approaching $+200\ ^\circ C$ [$+392\ ^\circ F$] or higher, induces migration of the copper base metal through the silver coating. This may reduce the silver coating thickness and create porosity sites for cuprous/cupric oxide corrosion to occur. This effect is typically experienced in instances where the wiring is exposed to excessive heat during test or highly accelerated burn-in.

Chemical Attack

Exposure to chemicals present in the environment (e.g., oxygen, sulfur compounds, salt) may result in corrosion and corrosion by-products that attack and compromise the mechanical integrity of the silver coating. Common “green” packaging materials, paper wrapping materials, rubber bands, and cardboard boxes should be avoided because such materials often outgas small amounts of sulfur. Exposure to atomic oxygen (AO) in spaceflight applications has been shown to tarnish and pit exposed silver coatings.

Note: Although it is normally assumed that there is no moisture in the vacuum of space, the recent claim of evidence of algae growth on the outer surfaces of the International Space Station suggests that there may be sufficient water and oxygen present to make AO damage a concern for development of Red Plague in Low Earth Orbit (LEO) inclinations.

1 GENERAL REQUIREMENTS

1.1 Scope This document introduces design concepts, guidelines, procedures, practices, process attributes, and recommendations for the control and mitigation of performance and reliability risks associated with the use of silver-coated copper conductors and technology in the manufacture of electrical and electronic assemblies, including optical and metallic cable and wiring harness assemblies, and elements thereof.

1.2 Purpose The intent of this document is to provide guidelines and a template for the development and implementation of a Red Plague Control Plan (RPCP).

For purposes of this document:

- The Designer is the design agent for the User.
- The User is the individual, organization, company, contractually designated authority, or agency responsible for the procurement or design of electrical / electronic / electromechanical (EEE) hardware, and having the authority to define the class of equipment and any variation or restrictions to the requirements of this document (i.e., the originator / custodian of the contract detailing these requirements). The User is considered the Design Authority.
- The Supplier is considered the individual, organization or company which provides the Manufacturer (assembler) components (electrical, electronic, electromechanical, mechanical, printed boards, etc.) and/or materials (solder, flux, cleaning agents, etc.).
- The Manufacturer is considered the entity that provides a service or product to the User.

1.3 Applicability This document is targeted for applications where exposure to assembly processes, environmental conditions, and contamination may promote the development of cuprous oxide corrosion (Red Plague) in silver-coated copper wire, cable, and harness assemblies, and is applicable to all organizations involved in the design, manufacture, and installation of silver-coated copper wire, cable, and harness assemblies.

- The design concepts, guidelines, and procedures presented in this document are for guidance ONLY, and are not requirements. As such, the use of the words “**must**”, “**should**” and “**shall**” (and derivations thereof) have no special meaning in this document, and they do not indicate a binding criterion.
- This document is not binding, unless separately and specifically included by the applicable contract, approved drawing(s), or purchase order.

1.4 Commercial Off-The-Shelf (COTS) This document does not apply to Commercial-Off-The-Shelf (COTS) items. Designers considering the use of COTS hardware for applications described above are responsible for identifying and managing risks associated with hardware that was built without a control plan to reduce the harmful effects of Red Plague.

1.5 Existing or Previously Approved Designs The implementation of a Red Plague Control Plan (RPCP) should not constitute the sole cause for the redesign of previously approved designs. When drawings for existing or previously approved designs undergo revision, they should be reviewed and changes made that allow for compliance with the requirements of the imposed Plan.



Figure 1-2 - Red Plague (Cuprous Oxide Corrosion)

Photo Courtesy of NASA

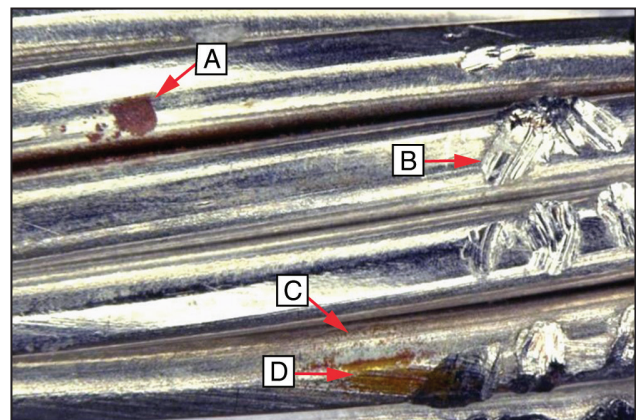


Figure 1-3 - Close-Up View AS22759 Stranded, Silver-Coated, Copper Wire Showing Varying Stages of Red Plague Damage *Photo Courtesy of NASA*

- Damaged Plating Site (Red Plague)
- Mechanical Damage (Recent)
- Porosity Sites with Red Plague
- Exposed Copper with Red Plague